3-Screen Display

High-Precision Digital Pressure Switch



General Fluids 1.0 MPa/2.0 MPa

5.0 MPa/10 MPa

It is possible to change the settings while checking the measured value.

Main screen

Measured value (Current pressure value)

Sub screen

Label (Display item), Set value (Threshold value)

Visualisation o	of Settings
Set value (Threshold value)	P_
Hysteresis value	H_
Peak value	$H_{\perp}H_{\perp}$
Bottom value	H_Lo



Angled display Good visibility from various mounting positions





336°



IO-Link

CE CAL US

RoHS

IP67





After installation, the display can be rotated to an easy-to-see direction by securing the body by hand.







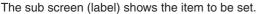

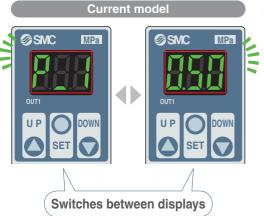







Simple 3-Step Setting

When the SET button is pressed and the set value (P_1) is being displayed, the set value (threshold value) can be set. When the SET button is pressed and the hysteresis value (H_1) is being displayed, the hysteresis value can be set.

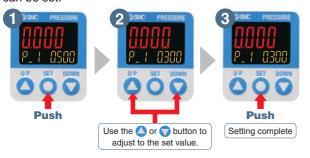

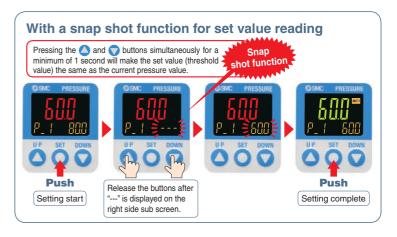

NPN/PNP Switch Function

Both NPN and PNP are available.

The number of stock items can be reduced.



Other Sub Screen Display

The peak value, bottom value, or both values can be displayed on one screen!

* Peak and bottom values are maintained even if the power supply is cut.





*1 "psi" and "bar" can be selected when the unit selection function is available. * A combination of the displays shown above and the set values can be displayed on the 2 sub screens.

Convenient Functions

Security code

The key-lock function keeps unauthorized persons from tampering with the settings.

■ Power-saving mode

Power consumption is reduced by turning off the monitor. (Reduce power consumption by approx. 60 %.)

■ Resolution switch function

Reduces monitor flickering



1/100

(Only the displayed values are changed; the accuracy remains the same.)


Applied pressure error

When the applied pressure exceeds the rated pressure, the pressure application is counted as an applied pressure error (the maximum number of applied pressure errors The number of applied is 1000 counts).



pressure errors



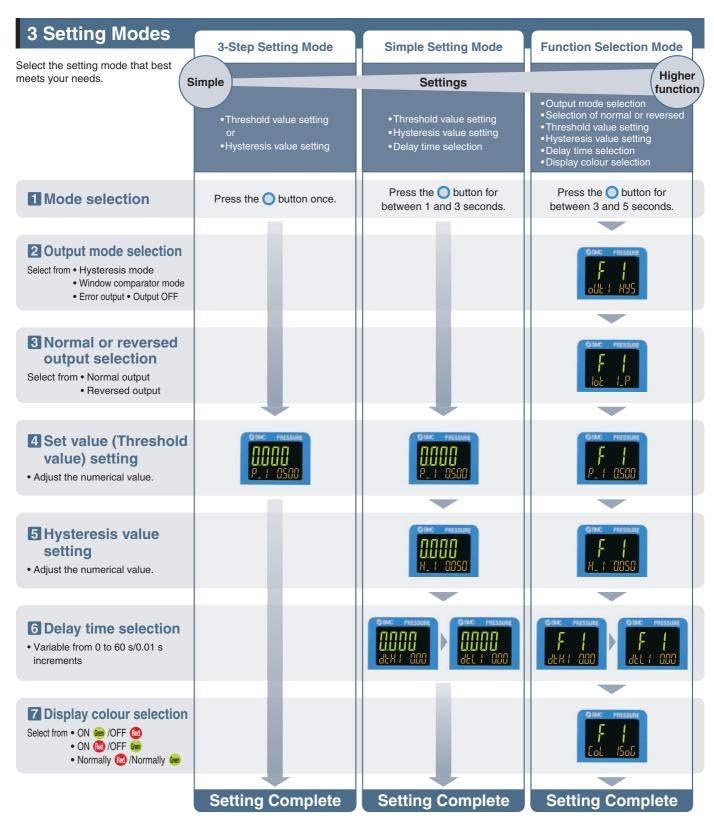


^{*} The chart above shows OUT1 operations. The Function Selection Mode for OUT2 is set using "F2." "2" will be displayed instead of "1" in the illustration above. (Example) P_1 → P_2



IO-Link Compatible

Visualisation of operation/equipment status/Remote monitoring and control by communication

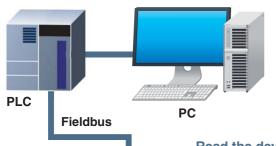

0-0

0-0

IO-Link Master

Configuration File (IODD File*1)

•Manufacturer •Product part no. •Set value

*1 IODD File:

IODD is an abbreviation of IO Device Description. This file is necessary for setting the device and connecting it to a master. Save the IODD file on the PC to be used to set the device prior to use.



IO-Link is an open communication interface technology between the sensor/actuator and the I/O terminal that is an international standard, IEC61131-9.

Device settings can be set by the master.

- •Threshold value
- Operation mode, etc.



- Manufacturer, Product part number, Serial number, etc.
- Normal or abnormal device status
- Cable breakage



Confirm the pressure condition during operation and monitor the device status.

Monitor the abnormal pressure and the abnormal status of a pressure sensor remotely to prevent unexpected stops.



IO-Link Compatible Device: Pressure Sensor

Diagnosis items

· Internal product malfunction

· Outside of zero-clear range

Outside of rated pressure range
 Upper temperature limit

exceeded inside the product

Implement diagnostic bits in the process data.

The diagnostic bit in the cyclic process data makes it easy to find problems with the equipment.

It is possible to find problems with the equipment in real time using the cyclic (cycle) data and to monitor such problems in detail with the noncyclic (aperiodic) data.

Process Data

Bit offset	Item	Note
0	OUT1 output	0: OFF 1: ON
1	OUT2 output	0: OFF 1: ON
2	Diagnosis	0: Normal 1: Abnormal
3 to 15	Measured pressure value	Unsigned 13 bit

Bit offset	15	14	13	12	11	10	9	8	7	6	5	4	3	2	1	0
Item		Measured pressure value								·	Diagnosis	OUT2	OUT1			

Display function

Displays the output communication status and indicates the presence of communication data










Operation and Display

Communication with master		k status or light	Status			Screen display*3	Description
		€ *2		ormal	Operate	ModE aPE	Normal communication status (readout of measured value)
			2		Start up	ModE Strt	At the start of communication
	0.0154			Preoperate	ModE PrE	At the start of communication	
Yes	COM*1	(Flashing)	IO-Link mode		Version does not match	Er 15	IO-Link version does not match that of the master. The master uses version 1.0.
				Abnormal	Lock	ModE LoC	Back-up and re-store required due to data storage lock
No	OFF				Abno	Communication disconnection	ModE oPE ModE SErE ModE PrE
		OFF	S	SIO n	node	ModE 5 io	General switch output

^{*1} The COM indicator is ON when communication with the master is established. *2 In IO-Link mode, the IO-Link indicator is ON or flashes. *3 When the sub screen is set to Mode

Introduction of Series

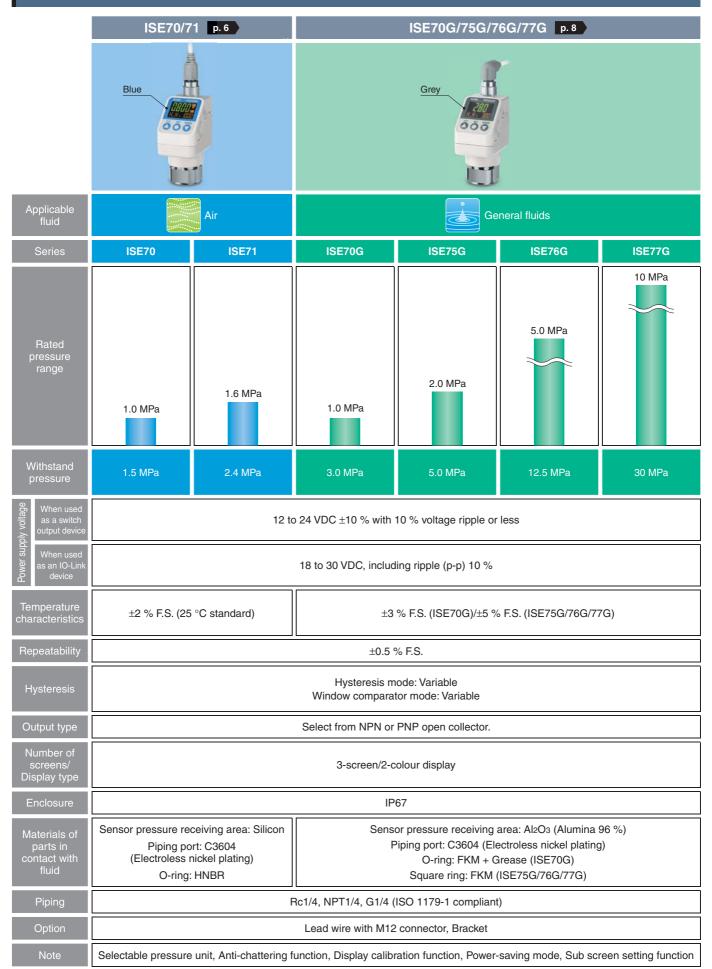



For details, refer to the web catalogue on www.smc.eu.

For General Fluids: Remote Type Variations

■ PSE56 Series

- Material of parts in contact with fluid: Stainless steel 316L
- Suitable for a wide variety of fluids
- Analogue output (Voltage/Current)
- · Select from a face seal or compression fitting.




■ PSE57 Series

- Withstand voltage: 500 VAC
- Materials of parts in contact with fluid Piping port: C3604 + Nickel plating Pressure sensor: Al2O3 (Alumina 96 %) O-ring: FKM + Grease (PSE570/573/574) Square ring: FKM (PSE575/576/577)



Select either the integrated type or the remote type according to the application.



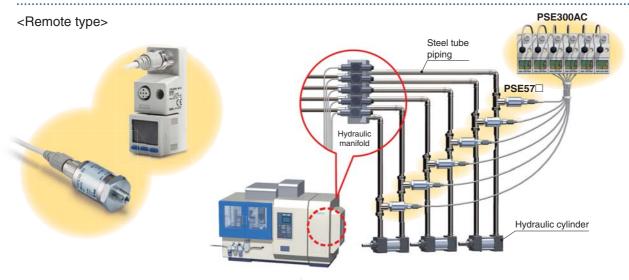


CONTENTS

3-Screen Display High-Precision **Digital Pressure Switch: For Air** IS



SE70/71 Series	
How to Order	 p. 6
Options/Part Nos.	 p. 6
Specifications	 p. 7

3-Screen Display High-Precision **Digital Pressure Switch: For General Fluids ISE70G/75G/76G/77G** Series

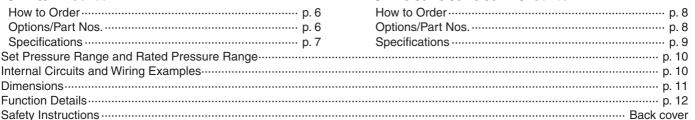



High-Precision Digital Pressure Switch: For Air

ISE70/71 Series



ISE70-02-L2-M

Pressure range

Symbol	Description
ISE70	0 to 1 MPa
ISE71	0 to 1.6 MPa

Piping specification

Symbol	Description
02	Rc1/4
N02	NPT1/4
F02	G1/4*1

^{*1} ISO 1179-1 compliant

Output specification*1

Symbol	Description
L2	IO-Link: Switch output 1 + Switch output 2 (Switch output: NPN or PNP switching type)
AB	Switch output 1 + Switch output 2 (NPN or PNP switching type)

^{*1} Refer to pages 7 and 10 for details.

Option 3

- pastro				
Symbol	Description			
_	Operation manual			
Υ	None			
К	Operation manual + Calibration certificate			
Т	Calibration certificate			

Option 2

Symbol	Description
_	None
Α	Bracket A (Interchangeable with ISE70)
В	Bracket B

Option 1

Symbol	Description
_	None
S	Lead wire with M12 connector (Straight, 5 m)
L	Lead wire with M12 connector (Right-angled, 5 m)

Unit specification

Symbol	Description
	Unit selection function
M	SI unit only*1

^{*1} Fixed unit: MPa, kPa

Options/Part Nos.

When only optional parts are required, order with the part numbers listed below.

Description		Part no.	Note
Bracket A		ZS-50-A	Interchangeable with ISE70 With 2 mounting screws (M4 x 6L)
Bracket B		ZS-50-B	With 2 mounting screws (M4 x 6L)
Lead wire with M12 connector: Straight		ZS-31-B	Lead wire length: 5 m
Lead wire with M12 connector: Right-angled		ZS-31-C	Lead wire length: 5 m



ISE70/71 Series

Specifications

For pressure switch precautions and specific product precautions, refer to the "Operation Manual" on the SMC website.

		Model	ISE70	ISE71				
Applicable	fluid		Air, Non-corrosive gas	s, Non-flammable gas				
	Rated pres	sure range	0 to 1.000 MPa	0 to 1.600 MPa				
D	Display/Se	t pressure range	-0.105 to 1.050 MPa	-0.105 to 1.680 MPa				
Pressure	Display/Sm	nallest settable increment	0.001 MPa	0.001 MPa				
	Withstand	pressure	1.5 MPa	2.4 MPa				
	Power	When used as a switch output device	12 to 24 VDC ±10 % with 10 % voltage ripple or less					
Power supply	supply voltage	When used as an IO-Link device	18 to 30 VDC, includ	18 to 30 VDC, including ripple (p-p) 10 %				
	Current consumption		35 mA	or less				
	Protection		Polarity p	Polarity protection				
	Display acc	curacy	±2 % F.S. ±1 digit (Ambien	t temperature of 25 ±3 °C)				
Accuracy	Repeatabil	ity	±0.5 °	% F.S.				
	Temperatu	re characteristics	±2 % F.S. (25	°C standard)				
	Output typ	e	Select from NPN or PN	P open collector output.				
	Output mo	de	Hysteresis, Window compara	tor, Error output, Output OFF				
Switch	Switch ope	eration	Normal output, I	Reversed output				
output (During SIO	Maximum I	load current	80	mA				
mode for	Maximum a	applied voltage	30 V (NP	N output)				
output	Internal vo	Itage drop (Residual voltage)	1.5 V or less (at loa	d current of 80 mA)				
specifica-	Delay time	*1	1.5 ms or less, variable from	0 to 60 s/0.01 s increments				
tions "AB" or "L2")	Hysteresis	Hysteresis mode	Variable	from 0*2				
	Tryotoroolo	Window comparator mode	VARIABIO IIOIII V					
	Short circu	it protection	Ye	es				
	Unit*3		MPa, kPa, kgf/cm², bar, psi					
	Display type		LCD					
Display	Number of screens		3-screen display (Main	•				
Diopidy	Display col		Main screen: Red/Gree	•				
		display digits	Main screen: 4 digits (7 segments), Sub screen: 4 dig					
	Indicator li	ght	Lights up when switch output is to					
Digital filte			Variable from 0 to 30					
	Enclosure		IP:	- -				
	Withstand		1000 VAC for 1 minute between terminals and housing					
Environment	Insulation		50 MΩ or more (500 VDC measured via megohmmeter) between terminals and housing Operating: 0 to 50 °C, Stored: -10 to 60 °C (No condensation or freezing)					
		temperature range						
	Operating	humidity range	Operating/Stored: 35 to 85	,				
Standards			UL/CSA (E2166	**				
	Port size		Rc1/4, NP	<u>'</u>				
Piping	Materials o	of parts in contact with fluid	1 01 (s nickel plating), O-ring: HNBR				
	_	Port size Rc1/4	153	· ·				
Weight	Body	Port size NPT1/4	152	*				
		Port size G1/4	150					
		with connector	139	<u> </u>				
	IO-Link typ		Device					
	IO-Link ver		V1.1					
		ation speed	COM2 (38.4 kbps)					
	Configurat		IODD file*5					
Communication (IO-Link mode)	Minimum c	•	2.3 ms					
(IO-LIIIK IIIOUE)	Process da		Input data: 2 bytes, Output data: 0 byte					
		t data communication	Yes					
	Data storage function		Yes					
	Event func	tion	Yes					
	Vendor ID		131 (0 x 0083)					

^{*1} Value without digital filter (at 0 ms)

^{*2} If the applied pressure fluctuates around the set value, the hysteresis must be set to a value more than the amount of fluctuation, or chattering will occur.

^{*3} Setting is only possible for models with the unit selection function. Only MPa or kPa is available for models without this function.

^{*4} The response time indicates when the set value is 90 % in relation to the step input.

^{*5} The configuration file can be downloaded from the SMC website, http://www.smcworld.com

^{*} Products with tiny scratches, marks, or display colour or brightness variations which do not affect the performance of the product are verified as conforming products.








High-Precision Digital Pressure Switch: For General Fluids

ISE70G/75G/76G/77G Series

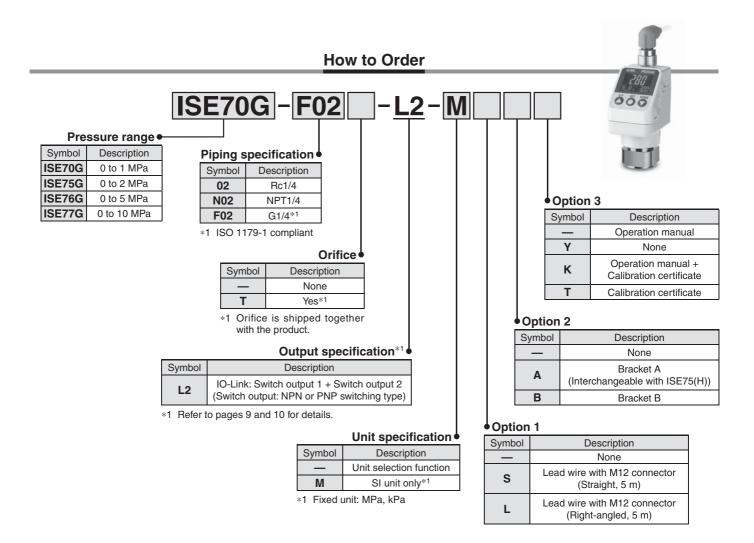

Options/Part Nos.

When only optional parts are required, order with the part numbers listed below

Descriptio	n	Part no.	Note
Orifice		ZS-48-A	Without orifice With orifice
Bracket A		ZS-50-A	Interchangeable with ISE75(H) With 2 mounting screws (M4 x 6L)
Bracket B		ZS-50-B	With 2 mounting screws (M4 x 6L)
Lead wire with M12 connector: Straight		ZS-31-B	Lead wire length: 5 m
Lead wire with M12 connector: Right-angled		ZS-31-C	Lead wire length: 5 m



ISE70G/75G/76G/77G Series

Specifications

For pressure switch precautions and specific product precautions, refer to the "Operation Manual" on the SMC website.

		Model	ISE70G ISE75G ISE76G ISE77G					
Applicable	fluid		Liquid or gas that will not corrode materials of parts in contact with fluid					
	Rated pres	sure range	0 to 1.000 MPa	0 to 2.000 MPa	0 to 5.00 MPa	0 to 10.00 MPa		
_	Display/Se	t pressure range	-0.105 to 1.050 MPa	-0.105 to 2.100 MPa	-0.25 to 5.25 MPa	-0.50 to 10.50 MPa		
Pressure		nallest settable increment	0.001 MPa	0.001 MPa	0.01 MPa	0.01 MPa		
-	Withstand		3.0 MPa	5.0 MPa	12.5 MPa	30 MPa		
	When used as a switch							
	Power supply	output device	12	12 to 24 VDC ± 10 % with 10 % voltage ripple or less				
Power supply	voltage	When used as an IO-Link device	18 to 30 VDC, including ripple (p-p) 10 %					
Ī	Current co	nsumption		35 mA	or less			
-	Protection			Polarity p	rotection			
	Display ac	curacy	±2	% F.S. ±1 digit (Ambien	t temperature of 25 \pm 3 $^{\circ}$	(C)		
Accuracy	Repeatabil	ity		±0.5 %	% F.S.			
	Temperatur	e characteristics (25°C standard)	±3 % F.S.		±5 % F.S.			
	Output typ			Select from NPN or PNI	P open collector output.			
	Output mo		Hysto	eresis, Window compara				
	Switch ope		,	Normal output, F				
}		oad current		80 i	<u>.</u>			
Switch		applied voltage		30 V (NPI				
output		Itage drop (Residual voltage)		1.5 V or less (at load	. /			
(SIO mode)	Delay time	<u> </u>	0 n	ns or less, variable from		nto.		
-	Delay IIII10		21	is of less, valiable fioliti	U TO OU S/U.UT S ITICIEME	illo		
	Hysteresis	Hysteresis mode		Variable	from 0*2			
-		Window comparator mode						
		uit protection		Ye				
	Unit*3		MPa, kPa, kgf/cm², bar, psi					
	Display type		LCD					
Display	Number of screens		3-screen display (Main screen, Sub screen x 2)					
	Display co			Main screen: Red/Gree	<u> </u>			
_		display digits		egments), Sub screen: 4 dig				
	Indicator li	ght	Lights up	when switch output is tu		: Orange)		
Digital filte	r*4			Variable from 0 to 30	s/0.01 s increments			
	Enclosure		IP67					
-	Withstand voltage		500 VAC for 1 minute between terminals and housing					
			50 M Ω or more (500 VDC measured via megohmmeter) between terminals and housing					
Environment	Insulation	resistance	Operating: -5 to 50 °C, Stored: -10 to 60 °C (No condensation or freezing)					
Environment	Insulation	resistance temperature range	Operating: -5	to 50 °C, Stored: -10 to	60 °C (No condensation	n or freezing)		
Environment	Insulation Operating			5 to 50 °C, Stored: -10 to perating/Stored: 35 to 85				
Environment Standards	Insulation Operating Operating	temperature range			% RH (No condensation			
	Insulation Operating Operating	temperature range		perating/Stored: 35 to 85	% RH (No condensations), CE, RoHS			
	Operating Operating Port size	temperature range	O Sensor pressure receivir	perating/Stored: 35 to 85 UL/CSA (E2166	 7 RH (No condensation 1556), CE, RoHS 171/4, G1/4 8), Piping port: C3604 (E 	on) Electroless nickel plating),		
Standards	Insulation Operating Operating Port size Materials of	temperature range humidity range	O Sensor pressure receivir	perating/Stored: 35 to 85 UL/CSA (E2166 Rc1/4, NP ng area: Al ₂ O ₃ (Alumina 96	i % RH (No condensation 556), CE, RoHS T1/4, G1/4 %), Piping port: C3604 (E Square ring: FKM (2, 5, 10	on) Electroless nickel plating),		
Standards	Operating Operating Port size	temperature range humidity range of parts in contact with fluid	O Sensor pressure receivir	perating/Stored: 35 to 85 UL/CSA (E2166 Rc1/4, NP ng area: Al ₂ O ₃ (Alumina 96 r: FKM + Grease (1 MPa), \$	i % RH (No condensation 556), CE, RoHS T1/4, G1/4 %), Piping port: C3604 (E Square ring: FKM (2, 5, 10	on) Electroless nickel plating),		
Standards	Insulation Operating Operating Port size Materials of	temperature range humidity range of parts in contact with fluid Port size Rc1/4	O Sensor pressure receivir	perating/Stored: 35 to 85 UL/CSA (E2166 Rc1/4, NP ng area: Al2O3 (Alumina 96 : FKM + Grease (1 MPa), \$	5 % RH (No condensation 556), CE, RoHS T1/4, G1/4 %), Piping port: C3604 (E Square ring: FKM (2, 5, 10 4 g	on) Electroless nickel plating),		
Standards	Insulation Operating Operating Port size Materials of	temperature range humidity range of parts in contact with fluid Port size Rc1/4 Port size NPT1/4	O Sensor pressure receivir	perating/Stored: 35 to 85 UL/CSA (E2166 Rc1/4, NP ng area: Al2O3 (Alumina 96 I: FKM + Grease (1 MPa), \$ 182	i % RH (No condensations) 56), CE, RoHS T1/4, G1/4 %), Piping port: C3604 (ESquare ring: FKM (2, 5, 10) 4 g 3 g 1 g	on) Electroless nickel plating),		
Standards Piping	Operating Operating Port size Materials of	temperature range humidity range of parts in contact with fluid Port size Rc1/4 Port size NPT1/4 Port size G1/4	O Sensor pressure receivir	perating/Stored: 35 to 85 UL/CSA (E2166 Rc1/4, NP ng area: Al ₂ O ₃ (Alumina 96 i: FKM + Grease (1 MPa), \$ 182 183	i % RH (No condensation 56), CE, RoHS T1/4, G1/4 %), Piping port: C3604 (ESquare ring: FKM (2, 5, 10), 3 g 1 g 9 g	on) Electroless nickel plating),		
Standards Piping	Insulation Operating Operating Port size Materials of	temperature range humidity range of parts in contact with fluid Port size Rc1/4 Port size NPT1/4 Port size G1/4 Lead wire with connector	O Sensor pressure receivir	perating/Stored: 35 to 85 UL/CSA (E2166 Rc1/4, NP ng area: Al ₂ O ₃ (Alumina 96 i: FKM + Grease (1 MPa), \$ 182 183 184	i % RH (No condensation 556), CE, RoHS T1/4, G1/4 %), Piping port: C3604 (ESquare ring: FKM (2, 5, 10) 4 g 3 g 1 g 9 g 7 g	on) Electroless nickel plating),		
Standards Piping	Operating Operating Port size Materials of	temperature range humidity range of parts in contact with fluid Port size Rc1/4 Port size NPT1/4 Port size G1/4 Lead wire with connector Bracket A	O Sensor pressure receivir	perating/Stored: 35 to 85 UL/CSA (E2166 Rc1/4, NP ng area: Al ₂ O ₃ (Alumina 96 ng: FKM + Grease (1 MPa), 18 183 183 17.	i % RH (No condensation 556), CE, RoHS F1/4, G1/4 %), Piping port: C3604 (ESquare ring: FKM (2, 5, 10) 4 g 3 g 1 g 9 g 7 g	on) Electroless nickel plating),		
Standards Piping	Operating Operating Port size Materials of	temperature range humidity range of parts in contact with fluid Port size Rc1/4 Port size NPT1/4 Port size G1/4 Lead wire with connector Bracket A Bracket B Orifice	O Sensor pressure receivir	perating/Stored: 35 to 85 UL/CSA (E2166 Rc1/4, NP ng area: Al ₂ O ₃ (Alumina 96 ng: FKM + Grease (1 MPa), \$ 184 185 17. 14.	i % RH (No condensation 566), CE, RoHS T1/4, G1/4 %), Piping port: C3604 (ESquare ring: FKM (2, 5, 10) 4 g 3 g 1 g 9 g 7 g	on) Electroless nickel plating),		
Standards Piping	Operating Operating Operating Port size Materials of Body Option	temperature range humidity range of parts in contact with fluid Port size Rc1/4 Port size NPT1/4 Port size G1/4 Lead wire with connector Bracket A Bracket B Orifice	O Sensor pressure receivir	perating/Stored: 35 to 85 UL/CSA (E2166 Rc1/4, NP ng area: Al ₂ O ₃ (Alumina 96 ng: FKM + Grease (1 MPa), s 184 185 17. 14. 1.2	i % RH (No condensation 566), CE, RoHS F1/4, G1/4 %), Piping port: C3604 (ESquare ring: FKM (2, 5, 10) 4 g 3 g 1 g 9 g 7 g 2 g	on) Electroless nickel plating),		
Standards Piping	Operating Operating Operating Port size Materials of Body Option IO-Link typ IO-Link ver	temperature range humidity range of parts in contact with fluid Port size Rc1/4 Port size NPT1/4 Port size G1/4 Lead wire with connector Bracket A Bracket B Orifice	O Sensor pressure receivir	perating/Stored: 35 to 85 UL/CSA (E2166 Rc1/4, NP ng area: Al ₂ O ₃ (Alumina 96 ng: FKM + Grease (1 MPa), \$ 184 185 17. 14. 1.2 Dev	i % RH (No condensation 566), CE, RoHS T1/4, G1/4 %), Piping port: C3604 (ESquare ring: FKM (2, 5, 1049) 3 g 1 g 9 g 7 g 2 g 2 g vice .1	on) Electroless nickel plating),		
Standards Piping	Operating Operating Operating Port size Materials of Body Option IO-Link typ IO-Link ver Communic	temperature range humidity range of parts in contact with fluid Port size Rc1/4 Port size NPT1/4 Port size G1/4 Lead wire with connector Bracket A Bracket B Orifice Decision action speed	O Sensor pressure receivir	perating/Stored: 35 to 85 UL/CSA (E2166 Rc1/4, NP ng area: Al ₂ O ₃ (Alumina 96 ng: FKM + Grease (1 MPa), see 188 189 1189 177 14 Dev	i % RH (No condensations) i % RH (No condensations) i % RH (No condensations) i % (RH (A	on) Electroless nickel plating),		
Standards Piping Weight	Operating Operating Operating Operating Port size Materials of Body Option IO-Link typ IO-Link ver Communic Configurat	temperature range humidity range of parts in contact with fluid Port size Rc1/4 Port size NPT1/4 Port size G1/4 Lead wire with connector Bracket A Bracket B Orifice oe rsion ation speed ion file	O Sensor pressure receivir	perating/Stored: 35 to 85 UL/CSA (E2166 Rc1/4, NP g area: Al ₂ O ₃ (Alumina 96 ; FKM + Grease (1 MPa), \$ 183 183 17. 14. Dev V1 COM2 (3:	i % RH (No condensation in the state of the	on) Electroless nickel plating),		
Standards Piping Weight Communication	Operating Operat	temperature range humidity range of parts in contact with fluid Port size Rc1/4 Port size NPT1/4 Port size G1/4 Lead wire with connector Bracket A Bracket B Orifice be resion ation speed ion file	O Sensor pressure receivir	perating/Stored: 35 to 85 UL/CSA (E2166 Rc1/4, NP g area: Al ₂ O ₃ (Alumina 96 ; FKM + Grease (1 MPa), \$ 183 183 17. 14. Dev V1 COM2 (3: IODD 2.3	i % RH (No condensation in the state of the	on) Electroless nickel plating),		
Standards Piping Weight	Operating Operat	temperature range humidity range of parts in contact with fluid Port size Rc1/4 Port size NPT1/4 Port size G1/4 Lead wire with connector Bracket A Bracket B Orifice telesion ation speed ion file tycle time ata length	O Sensor pressure receivir	perating/Stored: 35 to 85 UL/CSA (E2166 Rc1/4, NP g area: Al2O3 (Alumina 96 ; FKM + Grease (1 MPa), \$ 183 183 17. 14. Dev V1 COM2 (3: IODD 2.3 Input data: 2 bytes,	i % RH (No condensation in the state of the	on) Electroless nickel plating),		
Standards Piping Weight Communication	Operating Operat	temperature range humidity range of parts in contact with fluid Port size Rc1/4 Port size NPT1/4 Port size G1/4 Lead wire with connector Bracket A Bracket B Orifice oe esion attion speed ion file cycle time atta length t data communication	O Sensor pressure receivir	perating/Stored: 35 to 85 UL/CSA (E2166 Rc1/4, NP g area: Al2O3 (Alumina 96): FKM + Grease (1 MPa), \$ 184 185 17. 14.: Dev V1 COM2 (3i IODD 2.3 Input data: 2 bytes,	6 % RH (No condensation of the condensation of	on) Electroless nickel plating),		
Standards Piping Weight Communication	Operating Operat	temperature range humidity range of parts in contact with fluid Port size Rc1/4 Port size NPT1/4 Port size G1/4 Lead wire with connector Bracket A Bracket B Orifice oe esion attion speed ion file cycle time atta length t data communication ge function	O Sensor pressure receivir	perating/Stored: 35 to 85 UL/CSA (E2166 Rc1/4, NP g area: Al2O3 (Alumina 96); FKM + Grease (1 MPa), \$ 184 185 177 14.: Dev V1 COM2 (36 IODD 2.3 Input data: 2 bytes,	6 % RH (No condensation of the condensation of	on) Electroless nickel plating),		
Standards Piping Weight Communication	Operating Operat	temperature range humidity range of parts in contact with fluid Port size Rc1/4 Port size NPT1/4 Port size G1/4 Lead wire with connector Bracket A Bracket B Orifice oe esion attion speed ion file cycle time atta length t data communication ge function	O Sensor pressure receivir	perating/Stored: 35 to 85 UL/CSA (E2166 Rc1/4, NP g area: Al2O3 (Alumina 96): FKM + Grease (1 MPa), \$ 184 185 17. 14.: Dev V1 COM2 (3i IODD 2.3 Input data: 2 bytes,	6 % RH (No condensation of the condensation of	on) Electroless nickel plating),		

^{*1} Value without digital filter (at 0 ms)

^{*} Products with tiny scratches, marks, or display colour or brightness variations which do not affect the performance of the product are verified as conforming products.



^{*2} If the applied pressure fluctuates around the set value, the hysteresis must be set to a value more than the amount of fluctuation, or chattering will occur.

^{*3} Setting is only possible for models with the unit selection function. For models without this function, only MPa or kPa is available for the ISE70G/ISE75G, and only MPa is available for the ISE76G/ISE77G.


^{*4} The response time indicates when the set value is 90 % in relation to the step input.

^{*5} The configuration file can be downloaded from the SMC website, http://www.smcworld.com



Set Pressure Range and Rated Pressure Range

Set the pressure within the rated pressure range. The set pressure range is the range of pressure within which switch output can be set. The rated pressure range is the range of pressure that satisfies the specifications (accuracy, linearity, etc.) of the product. Although it is possible to set a value outside the rated pressure range, the specifications cannot be guaranteed even if the value stays within the set pressure range.

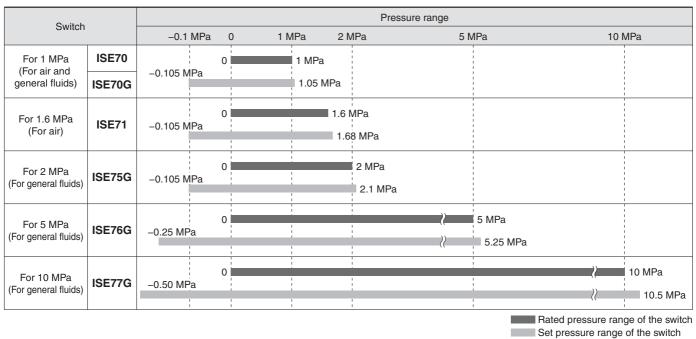


Internal Circuits and Wiring Examples

When used as a switch output device Setting of NPN open collector 2 outputs


Brown DC(+) 1 Black OUT1 4 7 Load Main circuit + 12 to 24 VDC White OUT2 2 本本 Blue DC(-) 3

* The numbers in the circuit diagrams show the connector pin layout.

Setting of PNP open collector 2 outputs

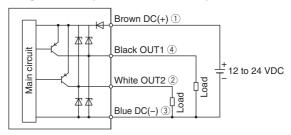


When used as an IO-Link device

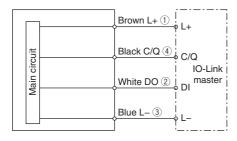


ISE7□/7□G Series


Dimensions

Without bracket

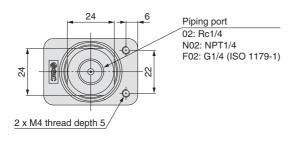


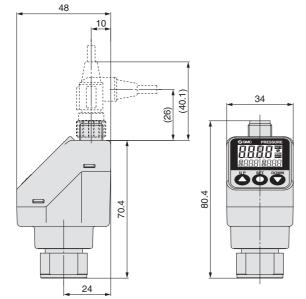


Bracket A (Interchangeable with ISE70/ISE75(H)) (Part no.: ZS-50-A)

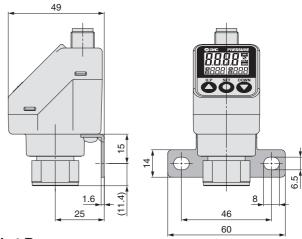



Bracket B (Part no.: ZS-50-B)

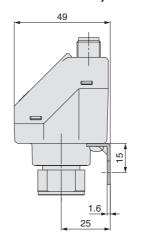

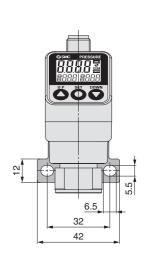



Lead wire with M12 connector (Part no.: ZS-31-B)

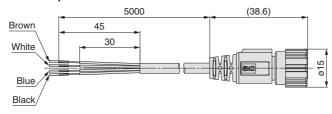

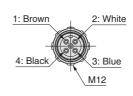

(Part no.: ZS-31-C)

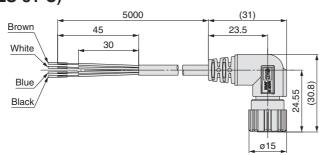

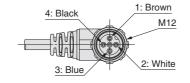

When used as a switch output device


The deed de de thier earpar de lies					
No.	Description	Lead wire colour	Note		
1	DC(+)	Brown	12 to 24 VDC		
2	OUT2	White	Switch output 2		
3	DC(-)	Blue	0 V		
4	OUT1	Black	Switch output 1		


When used as an IO-Link device


When does as an io Link dovice						
No.	Description	Lead wire colour	Note			
1	L+	Brown	18 to 30 VDC			
2	DO	White	Switch output 2			
3	L-	Blue	0 V			
4	C/Q	Black	Communication data (IO-Link)/ Switch output 1 (SIO)			


ISE7□/7□G Series Function Details


Display examples of the main and sub (set value) screens of each mode.

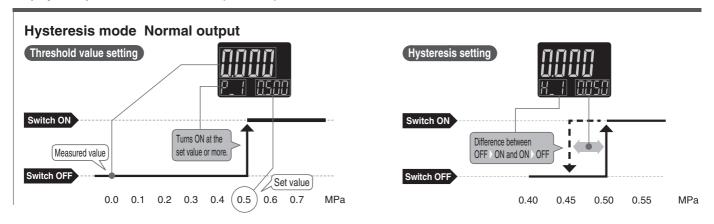


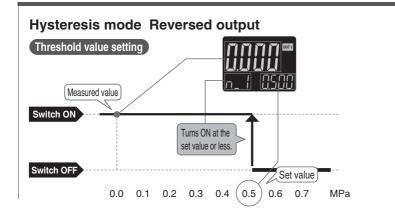


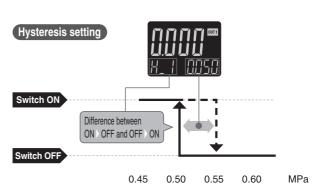

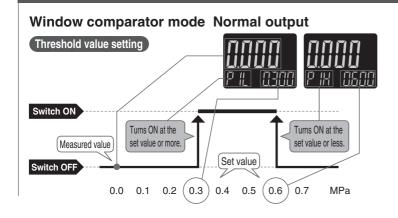

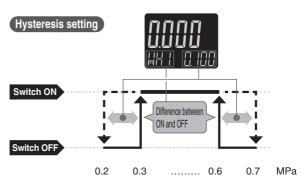

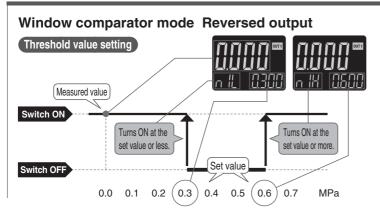

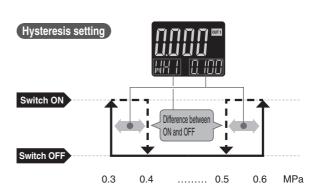

ISE7□/7□G Series

Function Details

A Auto-preset function (F4) * When using with IO-Link, the set values cannot be changed by communication.

Auto-preset function, when selected in the initial setting, calculates and stores the set value from the measured pressure.

Using this function is possible to automatically determine the optimum set value based on the variation in measured pressure due to the repeated operation of the device.

Formula for Obtaining the Set Value


Set value (Threshold value)	Hysteresis value		
$P_1(P_2) = A - (A-B)/4$	H_1(H_2) = (A-B)/2		
n 1(n 2) = B + (A-B)/4	$\Pi_1(\Pi_2) = (A-D)/2 $		

A: Maximum pressure value in auto preset mode

B: Minimum pressure value in auto preset mode

B Display value fine adjustment function (F6)

Fine adjustment of the indicated value of the pressure sensor can be made within the range of ± 5 % of the read value. (The scattering of the indicated value can be eliminated.)

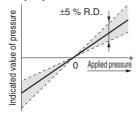

— Indicated value at a time of shipment
Adjustable range of display value fine adjustment function

* When the display value fine adjustment function is used, the set pressure value may change ±1 digit.

C Peak/Bottom value indication function

This function constantly detects and updates the maximum (minimum) pressure when the power is supplied, and allows to hold the maximum (minimum) pressure value.

The held value is maintained even if the power supply is cut. When the SET and DOWN buttons are simultaneously pressed for 1 second or longer, while "holding", the held value will be reset.

D Keylock function

Prevents operation errors such as accidentally changing setting values.

E Zero-clear function

This function clears and resets the zero value on the display of measured pressure.

The indicated value can be adjusted within ± 7 % F.S. of the pressure at a time of shipment from the factory.

F Error display function

This function is to display error location and content when a problem or error has occurred

Error name	Display	Description	Action
Over current error	Er 1 Er 2	The load current applied to the switch output has exceeded the maximum value.	Eliminate the cause of the over current by turning off the power supply and then turn it on again.
Residual pressure error	Er 3	During zero-clear operation, pressure over ± 7 % F.S. is present. Note that the mode is returned to measurement mode automatically 1 second later. The zero clear range varies by ± 1 % F.S. due to variation between individual products.	Perform zero-clear operation again after restoring the applied pressure to an atmospheric pressure condition.
Applied	XXX	Supply pressure exceeds the maximum set pressure.	Reset applied pressure to a level
pressure error		Supply pressure is below the minimum set pressure.	within the set pressure range.
System error	Er 0 Er 1 Er 4 Er 8 Er 6 Er 9	Internal data error	Turn the power off and then on again. If the error cannot be solved, please contact SMC for investigation.
IO-Link master version error	Er 15	IO-Link version does not match that of the master. The master uses version 1.0.	Ensure that the master IO-Link version matches the device version.

If the error cannot be solved after the instructions above are performed, or errors other than those above are displayed, please contact SMC for investigation.




Function Details

G Anti-chattering function (Simple setting mode or F1, F2)

A function to delay the switch output response time to prevent chattering or prevent the detection of temporary changes in source pressure. For example, large bore cylinders and ejectors consume a large volume of air in operation, therefore, the source pressure may decrease temporarily. The delay time can be set in the range of 0.00 to 60.00 [s] in 0.01 [s] increments.

<Principle>

This function averages pressure values measured during the response time set by the user and then compares the average pressure value with the pressure set point value to output the result on the switch.

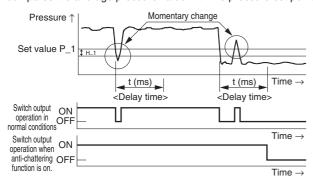

H Unit selection function (F0)

Display units can be switched with this function.

Madal	Model Rated pressure range MPa		Smallest settable increment					
iviodei			kPa	kgf/cm ²	bar	psi		
ISE70/70G	0 to 1 MPa		1	0.01	0.01	0.1		
ISE71	0 to 1.6 MPa	0.001						
ISE75G	0 to 2 MPa					0.2		
ISE76G	0 to 5 MPa	0.01		0.1	0.1	4		
ISE77G	0 to 10 MPa	0.01		0.1	0.1	'		

Zero cut-off setting (F14)

When the pressure display value is close to zero, this function forces the display to zero.

The range to display zero can be changed within the range of 0.0 to 10.0 %.

Example: When the ISE70 (1 MPa range), zero-cut value = 1.0 %, 0 is displayed in the range of -9 to 9 kPa.

J Power-saving mode (F80)

Power saving mode can be selected.

It shifts to the power-saving mode without button operation for 30 seconds.

It is set to the normal mode (Power-saving mode is OFF.) at a time of shipment from the factory.

(During power-saving mode, [ECo] will flash in the sub screen and the operation light is ON (only when the switch is ON).)

K Setting of security code (F81)

Users can select whether a security code must be entered to release key lock.

At a time of shipment from the factory, it is set such that the security code is not required.



⚠ Safety Instructions

These safety instructions are intended to prevent hazardous situations and/or equipment damage. These instructions indicate the level of potential hazard with the labels of "Caution," "Warning" or "Danger." They are all important notes for safety and must be followed in addition to International Standards (ISO/IEC)*1), and other safety regulations.

Caution indicates a hazard with a low level of risk **⚠** Caution: which, if not avoided, could result in minor or moderate injury **⚠** Warning:

Warning indicates a hazard with a medium level of risk which, if not avoided, could result in death or serious injury.

Danger indicates a hazard with a high level of risk ⚠ Danger: which, if not avoided, will result in death or serious injury. *1) ISO 4414: Pneumatic fluid power - General rules relating to systems. ISO 4413: Hydraulic fluid power – General rules relating to systems. IEC 60204-1: Safety of machinery – Electrical equipment of machines. (Part 1: General requirements)

ISO 10218-1: Manipulating industrial robots - Safety.

⚠ Warning

1. The compatibility of the product is the responsibility of the person who designs the equipment or decides its specifications.

Since the product specified here is used under various operating conditions, its compatibility with specific equipment must be decided by the person who designs the equipment or decides its specifications based on necessary analysis and test results. The expected performance and safety assurance of the equipment will be the responsibility of the person who has determined its compatibility with the product. This person should also continuously review all specifications of the product referring to its latest catalogue information, with a view to giving due consideration to any possibility of equipment failure when configuring the equipment.

2. Only personnel with appropriate training should operate machinery and equipment.

The product specified here may become unsafe if handled incorrectly. The assembly operation and maintenance of machines or equipment including our products must be performed by an operator who is appropriately trained and experienced.

- 3.Do not service or attempt to remove product and machinery/equipment until safety is confirmed.
 - 1. The inspection and maintenance of machinery/equipment should only be performed after measures to prevent falling or runaway of the driven objects have been
 - 2. When the product is to be removed, confirm that the safety measures as mentioned above are implemented and the power from any appropriate source is cut, and read and understand the specific product precautions of all relevant products carefully.
- 3. Before machinery/equipment is restarted, take measures to prevent unexpected operation and malfunction.
- 4. Contact SMC beforehand and take special consideration of safety measures if the product is to be used in any of the following conditions.
 - 1. Conditions and environments outside of the given specifications, or use outdoors or in a place exposed to direct sunlight
 - 2. Installation on equipment in conjunction with atomic energy, railways, air navigation, space, shipping, vehicles, military, medical treatment, combustion and recreation, or equipment in contact with food and beverages, emergency stop circuits, clutch and brake circuits in press applications, safety equipment or other applications unsuitable for the standard specifications described in the product catalogue
 - 3. An application which could have negative effects on people, property, or animals requiring special safety analysis.
 - 4. Use in an interlock circuit, which requires the provision of double interlock for possible failure by using a mechanical protective function, and periodical checks to confirm

Limited warranty and Disclaimer/ Compliance Requirements

The product used is subject to the following "Limited warranty and Disclaimer" and "Compliance Requirements". Read and accept them before using the product.

Limited warranty and Disclaimer

- 1. The warranty period of the product is 1 year in service or 1.5 years product is delivered, wichever is first.*2) the Also, the product may have specified durability, running distance or replacement parts. Please consult your nearest sales branch.
- 2. For any failure or damage reported within the warranty period which is clearly our responsibility, a replacement product or necessary parts will be provided. This limited warranty applies only to our product independently, and not to any other damage incurred due to the failure of the product.
- 3. Prior to using SMC products, please read and understand the warranty terms and disclaimers noted in the specified catalogue for the particular products
 - *2) Vacuum pads are excluded from this 1 year warranty.

A vacuum pad is a consumable part, so it is warranted for a year after it is delivered. Also, even within the warranty period, the wear of a product due to the use of the vacuum pad or failure due to the deterioration of rubber material are not covered by the limited warranty.

Compliance Requirements

- 1. The use of SMC products with production equipment for the manufacture of weapons of mass destruction (WMD) or any other weapon is strictly prohibited.
- 2. The exports of SMC products or technology from one country to another are governed by the relevant security laws and regulations of the countries involved in the transaction. Prior to the shipment of a SMC product to another country, assure that all local rules governing that export are known and followed.

⚠ Caution

1. The product is provided for use in manufacturing industries.

The product herein described is basically provided for peaceful use in manufacturing

If considering using the product in other industries, consult SMC beforehand and exchange specifications or a contract if necessary

If anything is unclear, contact your nearest sales branch

∕!\ Caution

SMC products are not intended for use as instruments for legal metrology.

Measurement instruments that SMC manufactures or sells have not been qualified by type approval tests relevant to the metrology (measurement) laws of each country Therefore, SMC products cannot be used for business or certification ordained by the metrology (measurement) laws of each country.

Safety Instructions

Be sure to read "Handling Precautions for SMC Products" (M-E03-3) before using.

SMC Corporation (Europe)

Austria Belgium Bulgaria Croatia Czech Republic Denmark Estonia Finland	\$\infty\$ +43 (0)2262622800\$ \$\infty\$ +32 (0)33551464\$ \$\infty\$ +359 (0)2807670\$ \$\infty\$ +385 (0)13707288\$ \$\infty\$ +420 541424611\$ \$\infty\$ +45 70252900\$ \$\infty\$ +372 6510370\$ \$\infty\$ +358 207513513\$	www.smc.at www.smcpneumatics.be www.smc.bg www.smc.hr www.smc.cz www.smcdk.com www.smcpneumatics.ee www.smc.fi	office@smc.at info@smcpneumatics.be office@smc.bg office@smc.hr office@smc.cz smc@smcdk.com smc@smcpneumatics.ee smcfi@smc.fi	Lithuania Netherlands Norway Poland Portugal Romania Russia Slovakia	### 370 5 2308118 ### 31 (0)205318888 ### 47 67129020 ### 48 222119600 ### 351 226166570 ### 40 213205111 ### 7 8127185445 ### 421 (0)413213212	www.smcl.lt www.smcpneumatics.nl www.smc-norge.no www.smc.pl www.smc.eu www.smcromania.ro www.smc-pneumatik.ru www.smc.sk	info@smclt.lt info@smcpneumatics.nl post@smc-norge.no office@smc.pl postpt@smc.smces.es smcromania@smcromania.ro info@smc-pneumatik.ru office@smc.sk
France	* +33 (0)164761000	www.smc-france.fr	info@smc-france.fr	Slovenia	2 +386 (0)73885412	www.smc.si	office@smc.si
Germany	2 +49 (0)61034020	www.smc.de	info@smc.de	Spain	* +34 902184100	www.smc.eu	post@smc.smces.es
Greece	* +30 210 2717265	www.smchellas.gr	sales@smchellas.gr	Sweden	2 +46 (0)86031200	www.smc.nu	post@smc.nu
Hungary	* +36 23513000	www.smc.hu	office@smc.hu	Switzerland	2 +41 (0)523963131	www.smc.ch	info@smc.ch
Ireland	* +353 (0)14039000	www.smcpneumatics.ie	sales@smcpneumatics.ie	Turkey	2 +90 212 489 0 440	www.smcpnomatik.com.tr	info@smcpnomatik.com.tr
Italy	* +39 0292711	www.smcitalia.it	mailbox@smcitalia.it	UK	2 +44 (0)845 121 5122	www.smcpneumatics.co.uk	sales@smcpneumatics.co.uk
Latvia	2 +371 67817700	www.smclv.lv	info@smclv.lv				